

DEPARTMENT OF TRANSPORTATION

DIVISION OF ENGINEERING SERVICES

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave.St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:**Siegenthaler, Peter**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-020268**Date Inspected:** 05-Feb-2011**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Qiu Wen**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** OBG**Summary of Items Observed:**

On this day CALTRANS OSM Quality Assurance (QA) Inspector Umesh Gaikwad was present during the times noted above for observations relative to the fabrication of the SAS Superstructure being performed by Zhenhua Port Machinery Company (ZPMC) at Changxing Island in Shanghai, China. QA observed and/or found the following:

This Quality Assurance (QA) Inspector observed the following work in progress:

Bay 14

OBG Seg 14W:

Repair welding of weld joint no: SEG3020D-052 [Bottom Plate (BP) 3092A to Floor beam (FB) 3343A, complete joint penetration (CJP) weld at panel point (PP) 128.3]. The welder is identified as 066038 and was observed welding in the 2G position. Welding process was identified as Shielded Metal Arc Welding (SMAW). ZPMC QC was identified as Mr. Wang Xiang Pin. The welding variables recorded by this QC appeared to comply with WPS: 345-SMAW-2G(2F)-FCM-Repair. Repair welding was done as per Critical Welding Repair (CWR) Report: B-CWR 2734 Rev-1. (Photograph is attached herewith).

Repair welding of weld joint no: SEG3020Y-030 [Bottom Plate (BP) 3091A to Longitudinal Diaphragm (LD) 3051A, complete joint penetration (CJP) weld in between Panel Point (PP) 127~127.3]. The welder is identified as 045246 and was observed welding in the 2G position. Welding process was identified as Shielded Metal Arc

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

Welding (SMAW). AB/F QA was identified as Mr. Xiao Jun Peng. The welding variables recorded by this QC appeared to comply with WPS: 345-SMAW-2G(2F)-FCM-Repair. Repair welding was done as per Critical Welding Repair (CWR) Report: B-CWR 2662 Rev-2.


Repair welding of weld joint no: SEG3020X-013 [Bottom Plate (BP) 3091A to Longitudinal Diaphragm (LD) 3049B, complete joint penetration (CJP) weld in between Panel Point (PP) 126~126.5]. The welder is identified as 066398 and was observed welding in the 2G position. Welding process was identified as Shielded Metal Arc Welding (SMAW). AB/F QA was identified as Mr. Xiao Jun Peng. The welding variables recorded by this QC appeared to comply with WPS: 345-SMAW-2G(2F)-FCM-Repair. Repair welding was done as per Critical Welding Repair (CWR) Report: B-CWR 2662 Rev-2.

The FCAW process on weld joint no: SEG3020K-042 (Stiffener on Sub Assembly (SA) 3409A to Longitudinal Diaphragm (LD) 3051A, CJP weld at PP127.3). The welder is identified as 069841 and was observed welding in the 1G position. ZPMC QC was identified as Mr. Wang Xiang Pin. The welding variables recorded by QC appeared to comply with WPS: B-T-2231-ESAB.

The FCAW process on weld joint no: SEG3020K-043 (Stiffener on Sub Assembly (SA) 3409A to Longitudinal Diaphragm (LD) 3051A, CJP weld at PP127.3). The welder is identified as 069841 and was observed welding in the 1G position. ZPMC QC was identified as Mr. Wang Xiang Pin. The welding variables recorded by QC appeared to comply with WPS: B-T-2231-ESAB.

The SMAW process on weld joint no: SEG3020E-058 [Longitudinal Diaphragm (LD) 3048A to I-stiffener on FB3344A, CJP weld at PP128.3]. The welder is identified as 067765 and was observed welding in the 4G position. ABF QA was identified as Wang Jiang Hua. The welding variables recorded by QA appeared to comply with WPS: B-P-2214-TC-U4b-FCM-1.

Unless otherwise noted, all work observed on this date appeared to generally comply with applicable contract documents.

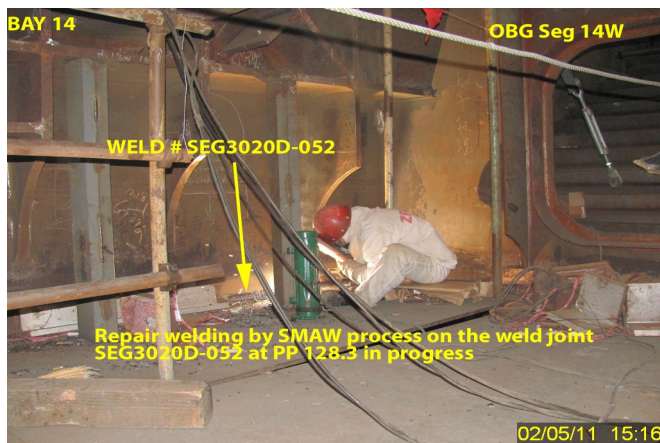

Summary of Conversations:

Only general conversation was held between QA and QC concerning this project.

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Eric Tsang : 15000422372, who represents the Office of Structural Materials for your project.

| | |
|----------------------|---------------|
| Inspected By: | Gaikwad,Umesh |
|----------------------|---------------|

| |
|-----------------------------|
| Quality Assurance Inspector |
|-----------------------------|

| | |
|---------------------|--------------|
| Reviewed By: | Peterson,Art |
|---------------------|--------------|

| |
|-------------|
| QA Reviewer |
|-------------|